


## 4. Calibration Mode

### 4.1 Calibration

Execute Weight Calibration and A/D related settings  
(Access Authorized CAS Tester only)

Open the tray and remove the calibration sealing.  
(CAUTION: Lift the tray Right side first and unlock the left side)

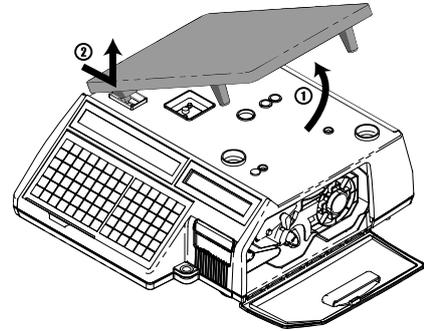

Order to access calibration mode:

 
Insert a stick into the CAL switch. Switch power on, while pushing the CAL button.



NOTE: For Hanging type: Pull forward the bottom handle to open  
Refer to each code of Program and Calibration Menu Tree.

First page of Calibration mode





### 4.1.1 Span Calibration (Menu Code 8110)


(Calibration MENU → Calibration → Span Calibration)

\*Requires set of certified weights. (For best result prepare 15kg/6kg (max) weights)

① Select "Span Calibration"



Press "PRINT"

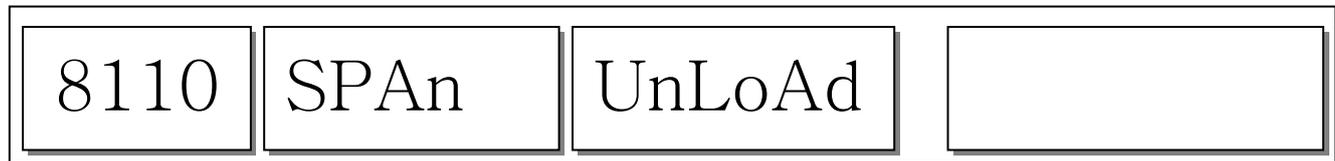

② Empty tray and press "PRINT"



While calibrating zero display shows "Wait4" ~ "Wait0" and follow next message for Span Calibration.



③ Put on the Weight for Max. Capacities then press "PRINT"

\*Menu 8130 sets the max capacity for calibration.



Display shows "Wait4" ~ "Wait0" then following message

